

CAUTION


If you are replacing this Kluver tube chiller due to the following reason;
Tube Oil pump is not turning (No 24VDC at Kluver tube chiller pins 1-2)
The K2 relay in the system cabinet is known to fail in a way that will chatter 230VAC and damage the Kluver circuit board.
If this happens the K2 relay must be replaced. It is located in the system cabinet.

This relay failure is usually intermittent and may be very difficult to catch in the failed state.

Always 24VDC with system on, if not replace K2

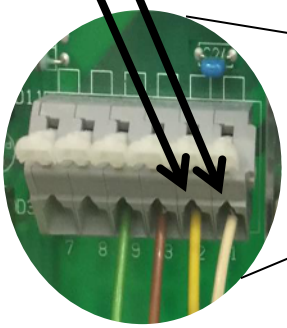

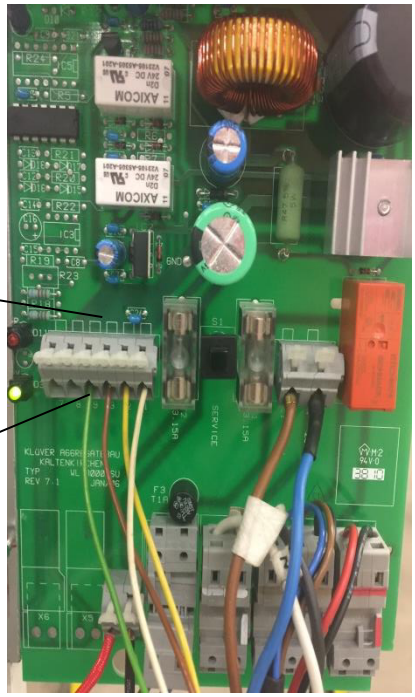

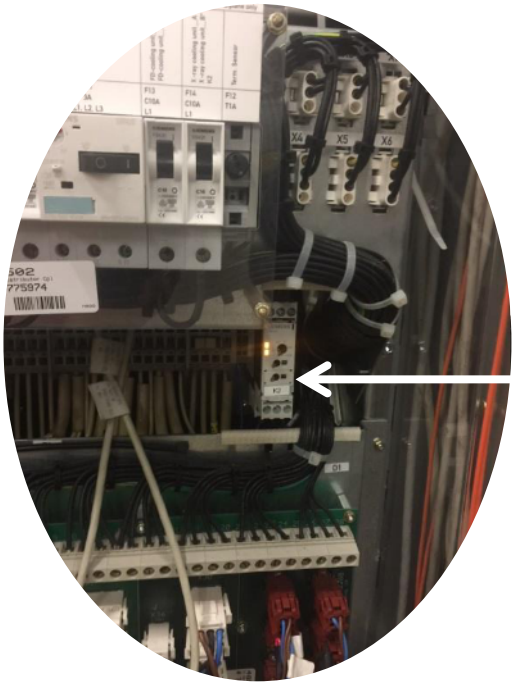

K2 Relay, Located in system cabinet