

Does the top of your helm chair pedestal look like this? Then please read below:



viking[®] yacht company

RECALL NOTIFICATION

September 2, 2016

Re: Murray Helm Chair Assembly - Viking Part Nos. VP#624558 VP#624639 and VP#624641

Dear: Boat Owner – each current boat owner certified and first purchaser (if not current owner), regular first class mail. Reference Hull#

Boat Dealer – one notification

Parts Seller – one notification

Viking Yacht Company has been notified that the above described component may be defective. The defect in the fabrication of the bushing linking the chair to the pedestal may result in the bushing breaking off completely, causing the occupant of the chair to be ejected. If the Murray chairs have been installed in helm, the ejection may cause the occupant to fall onto the deck below. Because of the nature of the installation, in which the chair base covers the bushing, damage or deflection to the bushing will not be visible. The breaking can occur suddenly and without notice. If the breaking occurs while the boat is underway, additional serious injury may occur. These Murray pedestals were installed on Viking Yachts between 2005 and 2013

THE MURRAY CHAIRS SHOULD NOT BE USED UNTIL THEY HAVE BEEN INSPECTED AND REPAIRED. IF YOU NOTICE ANY WOBBLE IN THE CHAIR OR IF THE PEDESTAL SEEMS CURVED, THESE ARE INDICATORS THAT THE BUSHING MAY BE WEAKENING.


Viking Yacht Company will replace or repair the part or any defective components at no cost to the owner.

If you no longer own the Viking Yacht with this chair, please contact Viking Yacht Company at your earliest convenience and provide us with any information you may have concerning the location and current owner of the yacht.

Please contact the following Viking Yacht representatives for additional information and scheduling:

Ray Connolly at 609-296-6000, rconnolly@vikingyachts.com in New Jersey, or Mike O'Hara at 561-493-2800, mohara@vikingyachts.com in Florida, or your servicing dealer.

Sincerely,
Viking Yacht Company

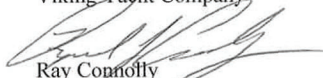

Ray Connolly
Customer Service Manager